



Fig. 1

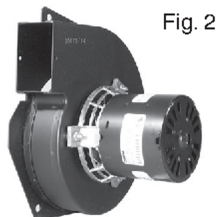


Fig. 2



Fig. 3

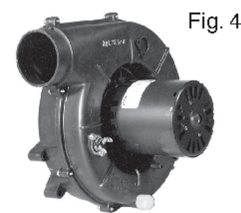


Fig. 4



Fig. 5

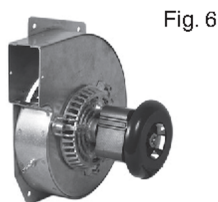


Fig. 6

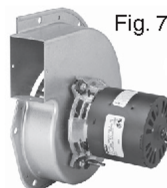


Fig. 7



Fig. 8



Fig. 9



Fig. 10



Fig. 11

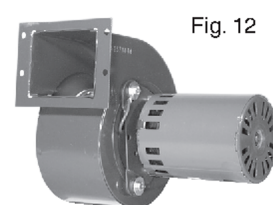


Fig. 12

Nordyne, Frigidaire, Miller

Part #	HP	Volts	Amps	Type	RPM	Rot.	Body	Frame	Bearing	Cap	Shaft	Cross	Fig
FB-RFB303	1/50	115	0.77	SP	1/3000	CW	7.6"	3.3"	Ball	-	-	512A, 303875	1
FB-RFB903 ¹	1/45	115	1.10	SP	1/3000	CCW	5.8"	3.3"	Sleeve	-	-	G5RA, G6RA, G3 Mid Eff. Res.: 903111, UE9454	2
FB-RFB902	1/20	115	0.70	PSC	1/3450	CCW	5.2"	3.3"	Sleeve	4/370	-	G5RC, G6RC, G1, G4 High Eff Res.: 902977	3

Olsen

Part #	HP	Volts	Amps	Type	RPM	Rot.	Body	Frame	Bearing	Cap	Shaft	Cross	Fig
FB-RFB140	1/50	115	1.49	SP	1/3400	CCW	5.6"	3.3"	Sleeve	-	-	Consolidated NUP 54-3, 72-3 High Eff. Res: 4246100, JAIN107NS	4
FB-RFB112 ³	1/45	115	1.30	SP	1/3000	CCW	6.0"	3.3"	Sleeve	-	-	Airco HMS/HMS-2T Mid Eff. Res: 26986, 26987, 28436	5
FB-RFB467	1/30	115	1.70	SP	3000	CCW	5.94"	Skel	Ball	-	-	29467	6
FB-RFB111	1/25	120	1.2	SP	1/3000	CCW	6.0"	3.3"	Sleeve	-	-	Residential: SBC375, CPL1132, 26607, 26573	7
FB-RFB130	1/25	115	0.70	PSC	1/3450	CCW	5.0"	3.3"	Ball	4/370	-	Consolidated NUP N12, 16, 20, 90-3, 108-5, 126-5 H.E. Res: 4246101	8
FB-RFB200 ²	1/24	115	1.8	SP	1/3200	CCW	6.6"	3.3"	Ball	-	-	HCS-2 High Eff. 60, 75, 81, 90 Right Hand Discharge Residential: 20082, 11051403	9
FB-RFB181 ²	1/22	115	1.2	SP	1/3320	CW	6.6"	3.3"	Ball	-	-	Airco High Eff HCS-2 60, 75, 81, 90 Left Hand Discharge Res: 18102	10
FB-RFB297 ¹	1/20	115	0.75	PSC	1/3450	CCW	6.25"	3.3"	Sleeve	4/370	-	29836, 29793, 7062-5511, 7062-6349	11
FB-RFB203	1/20	208/230	0.9	SP	1/3000	CCW	8.5"	3.3"	Ball	-	-	Com. Rooftop 3255A	12

*Notes:

1 - Comes with gasket

2 - Comes with three (3) brackets, fastening hardware, drain tubing & instructions.

3 - Includes pressure switch, two (2) gaskets, mounting plate, silicone tubing & instructions

Motors Are Sleeve Bearing Unless Indicated - Rotation Determined Opposite Shaft End (Double Shaft Determined By Lead End)